


## Crimp-on Procedure for BNC Connector

1) Trim cable as shown.



2) Slide crimp ferrule onto cable.


3) Fold braid back and complete trimming the cable as shown. Trim center conductor end at 45 degree angle.

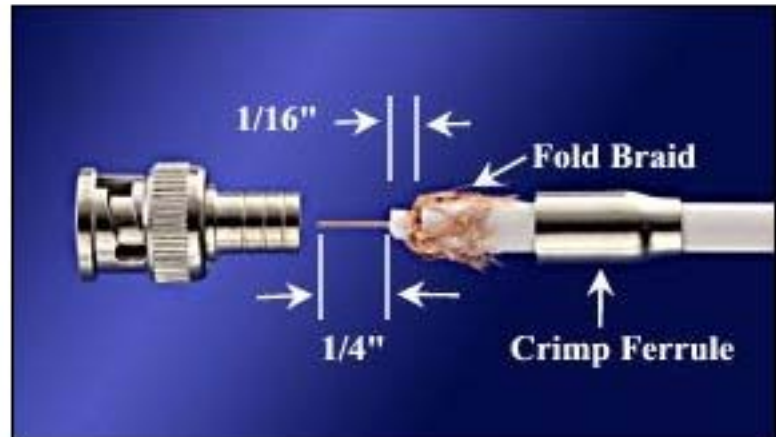

4) Push connector onto cable.

5) Fold braid back over crimp body.

6) Push crimp ferrule up over braid and crimp body.

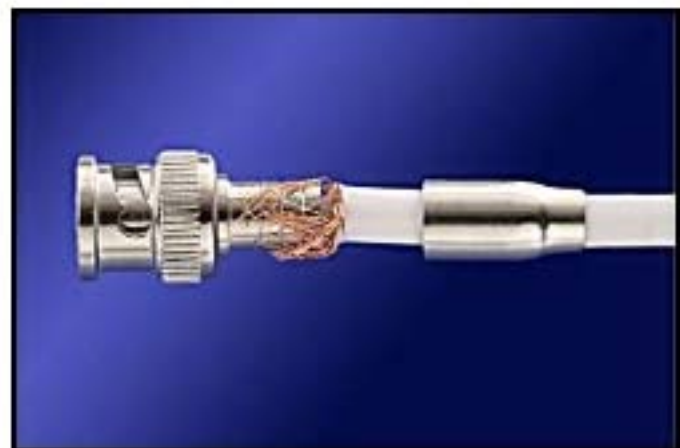

7) Using universal crimp tool P/N GET-301-UT, crimp ferrule to connector using .320 hex.

8) Crimp cable support with appropriate hex:

- .264 RG6PVC
- .250 RG59PVC, RG6TFE
- .212 RG59TFE, RG58PVC

